



DIY CNC Controller - Quick Start Guide -

- 1 Download & install the [grbl](#) software on your Arduino by clicking [here](#).

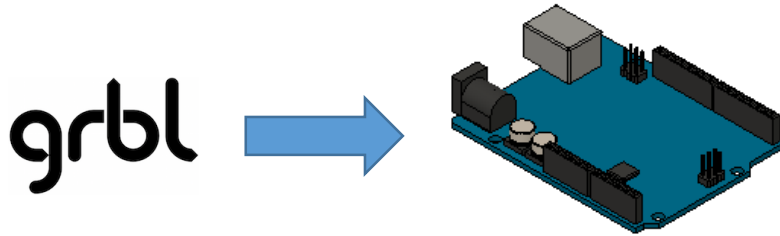


Be sure you have the latest Arduino IDE by clicking [here](#).

- 2 Download & install [universal gCode Sender](#) on your computer by clicking [here](#).

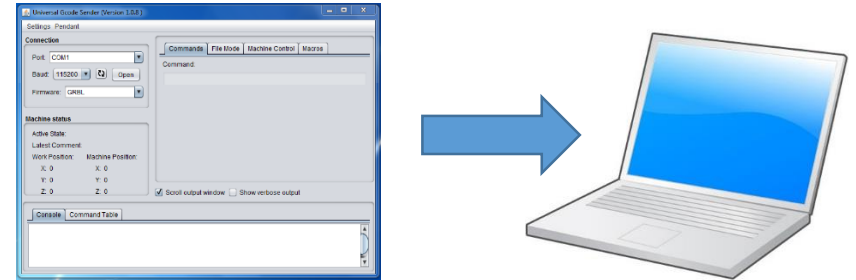

Be sure you have the latest version of Java by clicking [here](#).


- 3 Connect a power supply to your gShield

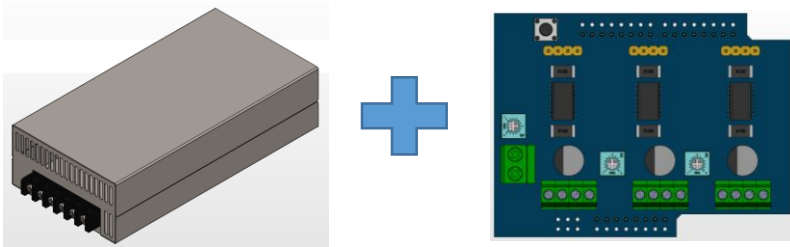

-Warning-

Ensure the polarity is correct when connecting the power supply to the gShield.

- 4 Attach the gShield to your Arduino and connect a stepper motor to the gShield.

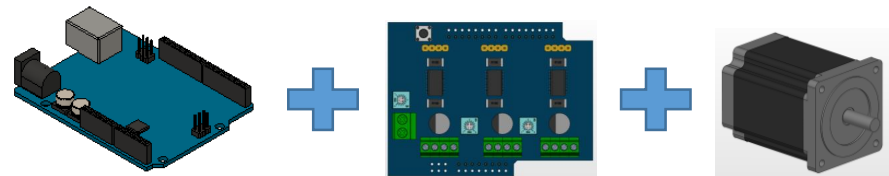

-Warning-

If you don't have an Arduino R3 click [here](#) to set the correct logic voltage jumper position.